



Lagnagrind:

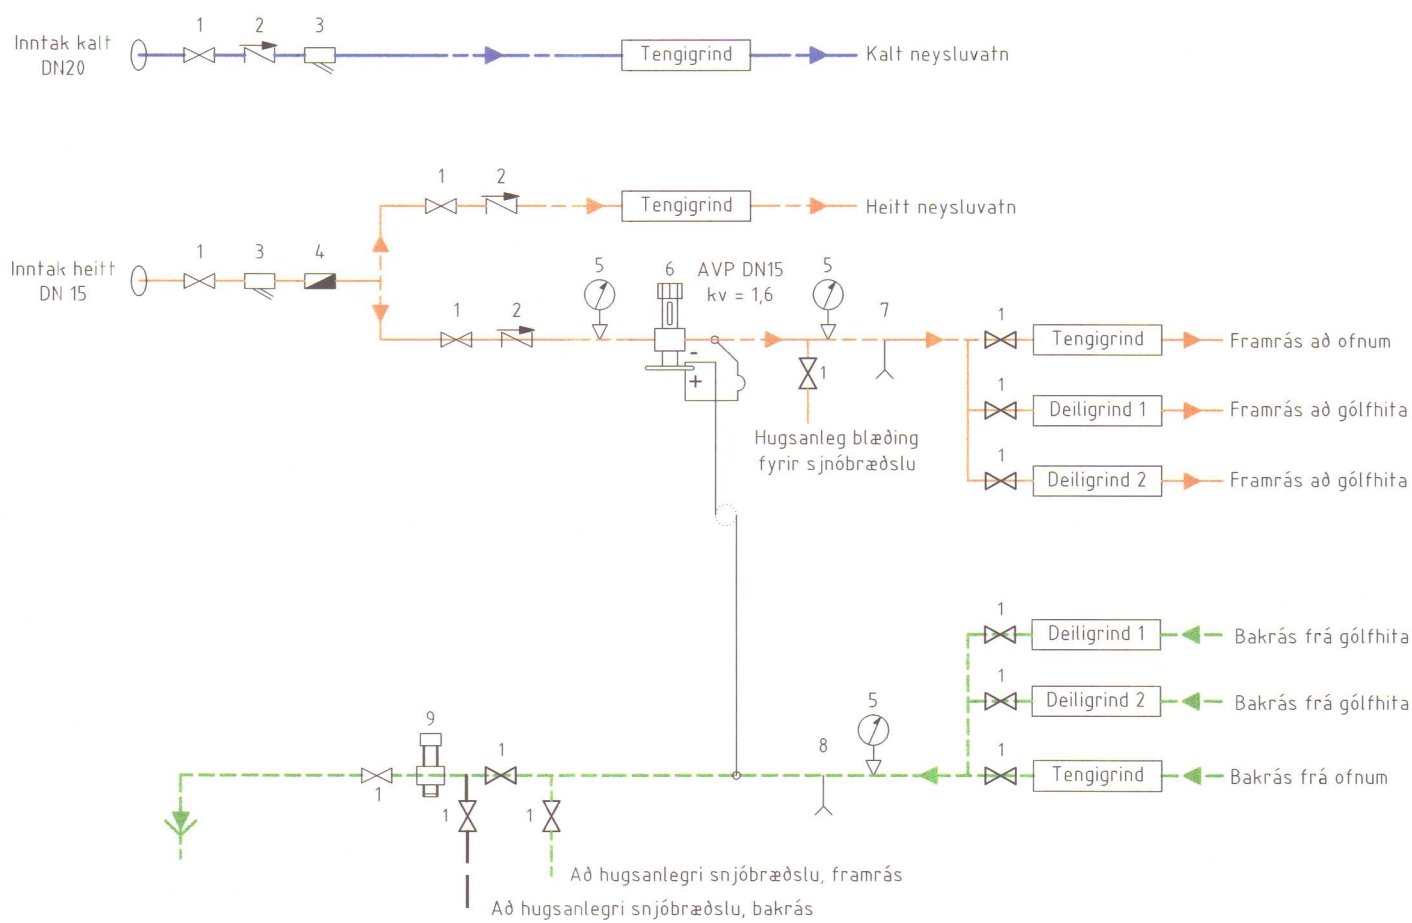

1. Kúluloki
2. Einstreymisloki
3. Sía
4. Rennslis- og magnmælir
5. Hita- og þrýsimælir
6. Mismunaprýsijafnari AVP (DN15 KV=1,6)
7. Öryggisloki
8. Tæming
9. Slaufuloki
10. Hítastýrður AVTB EDA RAVV lokið 0-30°C

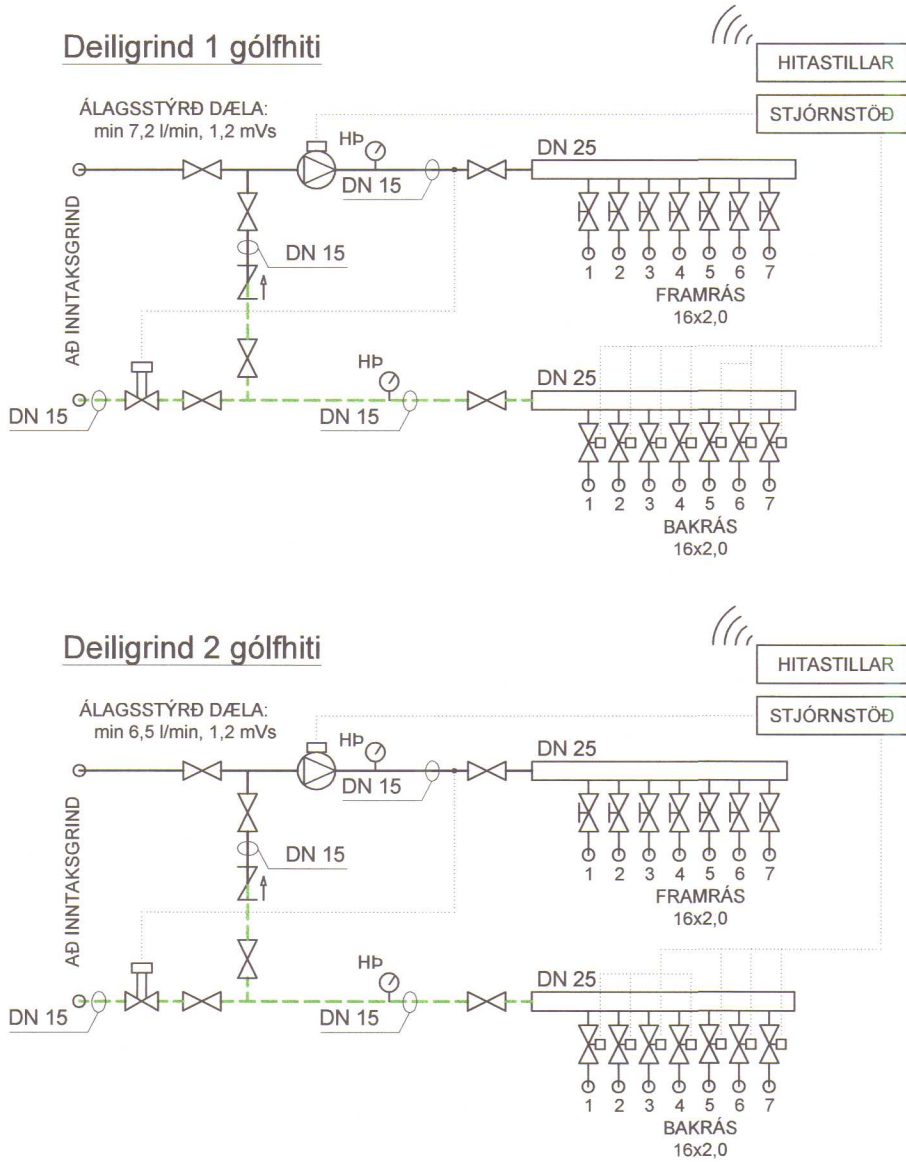

MÓTTEKIÐ
11. sep. 2018
Byggingarfulltrúinn
í Húnaþingi vestra

Grundartún 4 Ofnatafla										
Rými	Varmapörf [W]	Gólfhiti		Ofnar					Athugasemdir	Heildar afköst [W]
		Nr. Slaufu	Afköst gólfhitalagna [W]	Ofn nr.	Valin lengd [mm]	Valin hæð [mm]	Ofngerð	Afköst [W] Δt= 27,5°C		
Forstofa	400	2.7	396							396
Herbergi I	666	1.7	768							768
Þvottahúsi	568	1.3	632	102	500	950	Handkl.ofn	193	Bakrás	825
Bilgeymsla	2.989	1.6	1.350							2.633
		1.5	1.283							
Geymsla	422	1.4	837							837
Hjónaherbergi	1.103	1.1	1.192							1.192
Snyrting	462	1.2	528	101	500	950	Handkl.ofn	193	Bakrás	721
Herbergi II	603	2.5	688							688
Gangur	366	2.6	728							728
		2.4	924							
		2.3	935							
		2.2	1.012							
Eldhúsi/stofa	4.215	2.1	1.001							3.872
	11.794		12.274							12.660

SKANNAD

Br:		Dags:	
Grundartún 4, Hvammstanga			Teikn nr: P-100
Tengigrindur og ofnatafla Skýringar			Frumstærð: A2
Dags:	5. sept. 2018	Mkv: 1:50	V.nr: 3051
Áritun hönnuðar: <i>Ingvar G. Sigurðsson</i>			Hannað: IGS
			Teiknað: DEP
INGVAR GYGGJAR SIGURÐARSON Kt. 020884-3639 VÍÐIGRUND 22 550 SAUÐÁRKRÓKUR Sími 868-5052 NETFANG: IGS84@SIMNET.IS			